

## Fish Passage & Diversion Screening Inventory Database Report Cover Sheet

The following report is extracted from the Washington Department of Fish and Wildlife's (WDFW) Fish Passage and Diversion Screening Inventory Database (FPDSI). WDFW makes every attempt to keep these reports in sync with FPDSI; however, the dynamic nature of the data and workflows associated with maintaining the database may result in short-term differences.

Users are encouraged to contact WDFW to discuss appropriate use of the data and how we can assist with fish passage barrier removal or inventory. Please visit the Fish Passage web site for contact information at: https://wdfw.wa.gov/species-habitats/habitat-recovery/fish-passage/about

#### **Disclaimers:**

- Data presented here represent a snapshot observation of conditions in a dynamic environment
  that is subject to change. Fish passage data are also collected from a variety of agencies and
  sources. Therefore, WDFW makes no guarantee concerning the data's content, accuracy,
  completeness, or the results obtained from use of the data. WDFW assumes no liability for the
  data represented here.
- These data are not an attempt to provide you with an official agency response as to the impacts of your project on fish and wildlife.
- Note that some fish passage features, habitats or species may occur in areas not currently
  known to the WDFW Fish Passage division, and may not be reflected in this database. A lack of
  data does not necessarily indicate that a feature, habitat, or species are not present.
- Unauthorized attempts to alter or modify these data are strictly prohibited.
- Bankfull width measurements included in these reports should not be used for fish passage crossing design. They are solely for assessment purposes.
- The barrier status reported in this document is based on the swimming abilities of adult salmonids. Passabilities are a qualitative value, and should not be interpreted as a quantitative calculation. Please see page 1-4 of the Fish Passage Inventory, Assessment and Prioritization Manual for further clarification: https://wdfw.wa.gov/publications/02061
- EXIF data presented with Image Reports may be erroneous due to camera battery failures and resetting of camera clock functions.

#### Abbreviations:

Most abbreviations in this report are defined in the Quick Reference Tables of the Fish Passage Inventory, Assessment, and Prioritization Manual. Additional commonly used abbreviations are defined as follows:

**NFB** = no potential salmonid use, **BB** = both banks, **LB** = left bank looking downstream, **RB** = right bank looking downstream, **US** or **U/S** = upstream, **DS** or **D/S** = downstream, **WSDrop** = water surface drop, **BFW** = bankfull width, **OHW** = ordinary high water, **SLW** = scour line width, **CMP** = corrugated metal pipe, **Q**<sub>fp</sub> = fish passage flow, **V&D** = Velocity and Depth, **ROW** = Right of Way

The FPDSI database often uses default values such as '-99.99' or '-999' to represent null values.

### **WDFW Fish Passage and Diversion Screening Inventory Database**

### **Site Description Report**

<b>Site ID</b> 991242	Project	WSDOT		☐ Mitigated			
Geographic Coordinat	es	Waterboo	dy				
Latitude (WGS 84):	47.819009063	Stream:		unnamed			
Longitude (WGS 84):	-122.642708424	Tributar	/ To:	Kinman Cr			
East (NAD 83 HARN):	1,113,965.3	WRIA:		15			
North (NAD 83 HARN)	913,685.3	River Mi	Mile: 0.10				
		Fish Use	e Potential	: Yes			
General Location		FUP Cri	FUP Criteria: Biological				
Road Name:	SR 3	Owner					
Mile Post:	57.23	Type:	Type: State				
County:	Kitsap	Name:		on State Department			
WDFW Region:	6		of Transportation				
PI Species							
☐ Sockeye	☐ Chinook	Sea Run Cutthroat					
☐ Pink	✓ Coho		Resident Trout				
☐ Chum	Steelhead	☐ Bull Trout					
Associated Features							
✓ Culvert	☐ Dam	☐ Natural Ba	rrier	Diversion			
☐ Non-Culvert Xing	$\square$ Other	$\square$ Fishway	☐ Fishway				
Location/Directions							
Site Comments							
Chum observed in Kinman Cr (Fall 1997).							

11/19/2021

These data represent a snapshot of the Washington Department of Fish and Wildlife's current records. Due to the ongoing nature of assessment and inventory of these features, these data may not accurately represent conditions on the ground, and are subject to change.

#### **WDFW Fish Passage and Diversion Screening Inventory Database**

Level A Culvert Assessment Report												
Site ID:	991242											
Latitude:	47.819009	9063	S	ream:	unname	ed		WRI	<b>A</b> :	15		
Longitude:	-122.6427	08424	T	ibutary To:	Kinman	Cr		Fish	Use Potential:	Yes		
Data Source: Washington Department of Fish and Wildlife												
	Field C	rew:	Nettnin;\	Vhitney			Review D	)ate: 8/1	0/2004			
	Culvert Details Level A Parameters					<u></u>						
ID Shape	<u>Material</u>	<u>Span</u>	<u>Rise</u>	<u>Length</u>	<u>WDIC</u>	<u>Apron</u>	WSDrop	Location	Countersunk	Backwater	Slope (%)	Sedimen
1.1 RND	PCC	0.76	0.76	27.30	0.12	NO	0.00		No		2.64	
All dimension	ons in mete	ers										
Channel D		n —		1								
Average W	/idth (m):		2	.00	1	製金				1//		
Culvert/Str	eam Width	n Ratio:	0	.38		1						
Plunge Po	ool ——											
Length (m)	):		0	.00	1	1		70				



Assessment Ro	esults	Tidal Influence:		Tidegate Preser	nt: No
Barrier:	Yes	Passability (%):	0	Method:	Level A
Reason:	Slope	Fishway Present:	No	Recheck:	
Comments  No plunge pool.	Interior grade	brake. Water appears lev	vel untill upp	er 3-4 tile then slope ir	ncreases sharply.
Potential Habita	at Gain				
Survey Type:	RSFS	Spawning (s	sq m):	871	Length (m): 1,730

4,012

PI Total

14.71

Rearing (sq m):

Max Depth (m):

OHW Width (m):

Significant Reach:


Yes

Road -Fill Depth (m):

## WDFW Fish Passage and Diversion Screening Inventory Database Habitat Survey Summary Report

Site ID: 991242							
Latitude: <b>47.819009063</b> Long	itude: -122.642708	<b>124</b> WRIA:	15				
Stream: <b>unnamed</b> Tribu	tary To: Kinman Cr	PI Total:	14.71				
Survey Type RSFS							
Spreadsheet File(s):							
991242.XLS							
Downstream Survey							
Date: 10/22/1998	;Caudill Le	ngth (m): 170					
Downstream Comments:							
DC by G. Johnson & Caudill. 170 m	to confluence with Kinn	nan Cr, anadromous acces	s verified.				
Upstream Survey Date: 4/18/2012 Crew: Erkel;Stillwater;Romero Length (m): 1,730  Upstream Comments:  3% gradient US for 80 m, then 0% for 50 m, then 5% for next 70 m. Spawning fair, good rearing, high cover, high spring influence, some LWD, juveniles observed DS & US (8/4/11 notes).							
Potential Habitat Gain							
Lineal (m): 1,730  Spawning Area (sq m): 871  Rearing Area (sq m): 4,012	Distribution  Anadromous  Resident Only  Unknown	Gain Direction (Resider	nt Only):				
Potential Species Benefit							
$\square$ Sockeye / Kokanee	☐ Chinook	Searun Cutthroat					
☐ Pink	✓ Coho	Resident Trout					
☐ Chum	✓ Steelhead	☐ Bull Trout					

# WDFW Fish Passage and Diversion Screening Inventory Database Barrier Priority Index Report

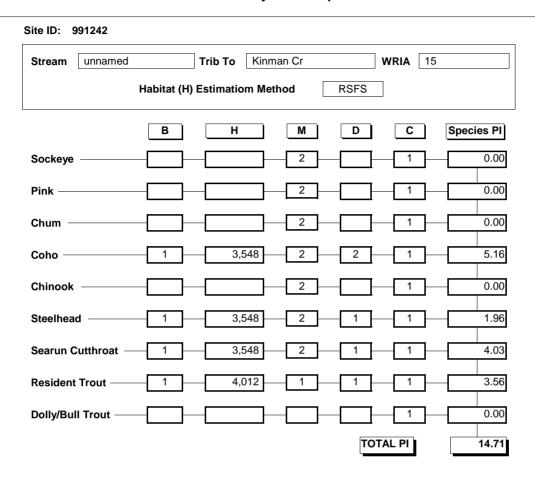

B = proportion of fish passage improvement (1, 0.67, 0.33).

H = potential habitat gain (square meters), spawning habitat for sockeye, pink and chum, rearing habitat for the rest.

M= mobility modifier (anadromous = 2, resident = 1).

D = stock condition modifier (critical = 3, depressed = 2, not 2 or 3 = 1).

C= repair cost modifier (<\$100K = 3, \$100K - \$500K = 2, >\$500K = 1).